


Dial Indicators

Comparison measuring instruments which ensure high quality, high accuracy and reliability.

DIMENSIONS


ISO/JIS
Type

Unit: mm

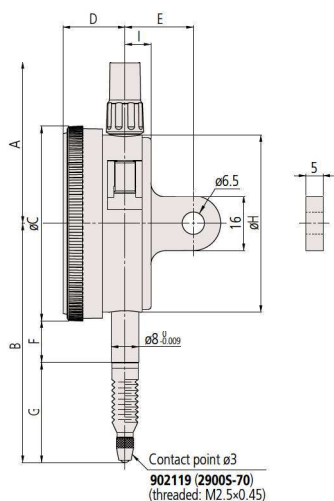

ANSI/AGD
Type

Unit: in

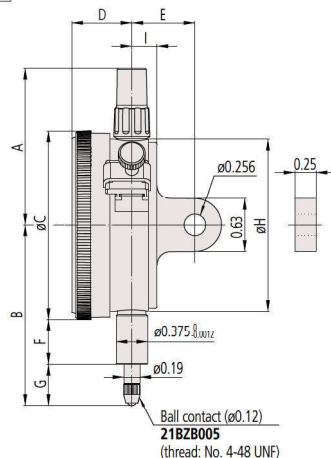

Order No.	A	B	C	D	E	F	G	H	I	Mass (g)	
										w/lug	Flat-back
2929A-60	47.2	70	57	18.1	20	12.3	29.2	52	7.6	146	137
2900A-70	47.2	67	57	18.1	20	12.3	26.2	52	7.6	150	141

Note: Refer to pages F-57 to F-60 for details of contact points.

Order No.	A	B	C	D	E	F	G	H	I	Mass (g)	
										w/lug	Flat-back
2910A-72	1.86	2.02	2.24	0.71	3/4	0.54	0.36	2.05	0.30	150	141

Note: Refer to pages F-57 to F-60 for details of contact points.

FEATURES

Metric							
Order No.		10 0 10	60	64	64	64	64
w/lug	Flat-back						
2929A-60	2929AB-60	✓	✓	✓	✓	✓	✓
2900A-70	2900AB-70	✓	✓	✓	✓	✓	✓

SPECIFICATIONS

Metric										ISO/JIS type	
Order No.		Graduation (mm)	Range (range/rev) (mm)	Maximum permissible error (MPE) (μm)					Dial reading	Measuring force (N)	
w/lug	Flat-back			Indication error				Hysteresis			Repeat- ability
				1/10 Rev	1/2 Rev	1 Rev	Measuring range				
2929A-60	2929AB-60	0.01	0.8 (1)	5	—	—	8	3	3	40-0-40	2.0 or less
2900A-70	2900AB-70	0.001	0.08 (0.1)	2	—	—	3	2	0.5	40-0-40	2.0 or less

Note: Completed products inspection is performed in the vertical orientation (contact point downward) and the stated accuracy is guaranteed.

Inch							
Order No.		10 0 10	60	64	64	64	64
w/lug	Flat-back						
2910A-72	2910AB-72	✓	✓	✓	✓	✓	✓

Inch										ANSI/AGD type	
Order No.		Graduation (in)	Range (range/rev) (in)	Accuracy (in)		Repeat- ability (in)	Dial reading	Measuring force (N)			
w/lug	Flat-back			First 1 Rev/2.5 Rev/10 Rev	Retrace						
2910A-72	2910AB-72	0.0001	0.008/0.01	±0.0001/—/—		0.0001	±0.00003	4-0-4	2.5 or less		

Note: Completed products inspection is performed in the vertical orientation (contact point downward) and the stated accuracy is guaranteed.

Optional Accessories

- Limit hand (2 pcs.): **21AZB195**
- Bezel clamp: **21AZB148**